

GENERAL ELECTRIC

MOD: GE 14091/GE 20091


ALL INTEGRATED CIRCUITS AND MANY OTHER SEMICONDUCTORS ARE ELECTROSTATICALLY SENSITIVE AND REQUIRE SPECIAL HANDLING TECHNIQUES DESCRIBED UNDER "ELECTROSTATICALLY SENSITIVE (ES) DEVICES" IN THE SAFETY AND SERVICING PRECAUTIONS PUBLICATION.

PRODUCT SAFETY NOTE
COMPONENTS WITH A Δ HAVE SPECIAL CHARACTERISTICS IMPORTANT TO SAFETY. BEFORE REPLACING ANY OF THESE COMPONENTS READ CAREFULLY THE PRODUCT SAFETY NOTICE IN THIS SERVICE DATA. DO NOT DEGRADE THE SAFETY OF THE SET THROUGH IMPROPER SERVICING.

NOTE: VOLTAGES IN PARENTHESES MEASURED IN STANDBY MODE.

"HOT" "COLD"


"HOT" "COLD"

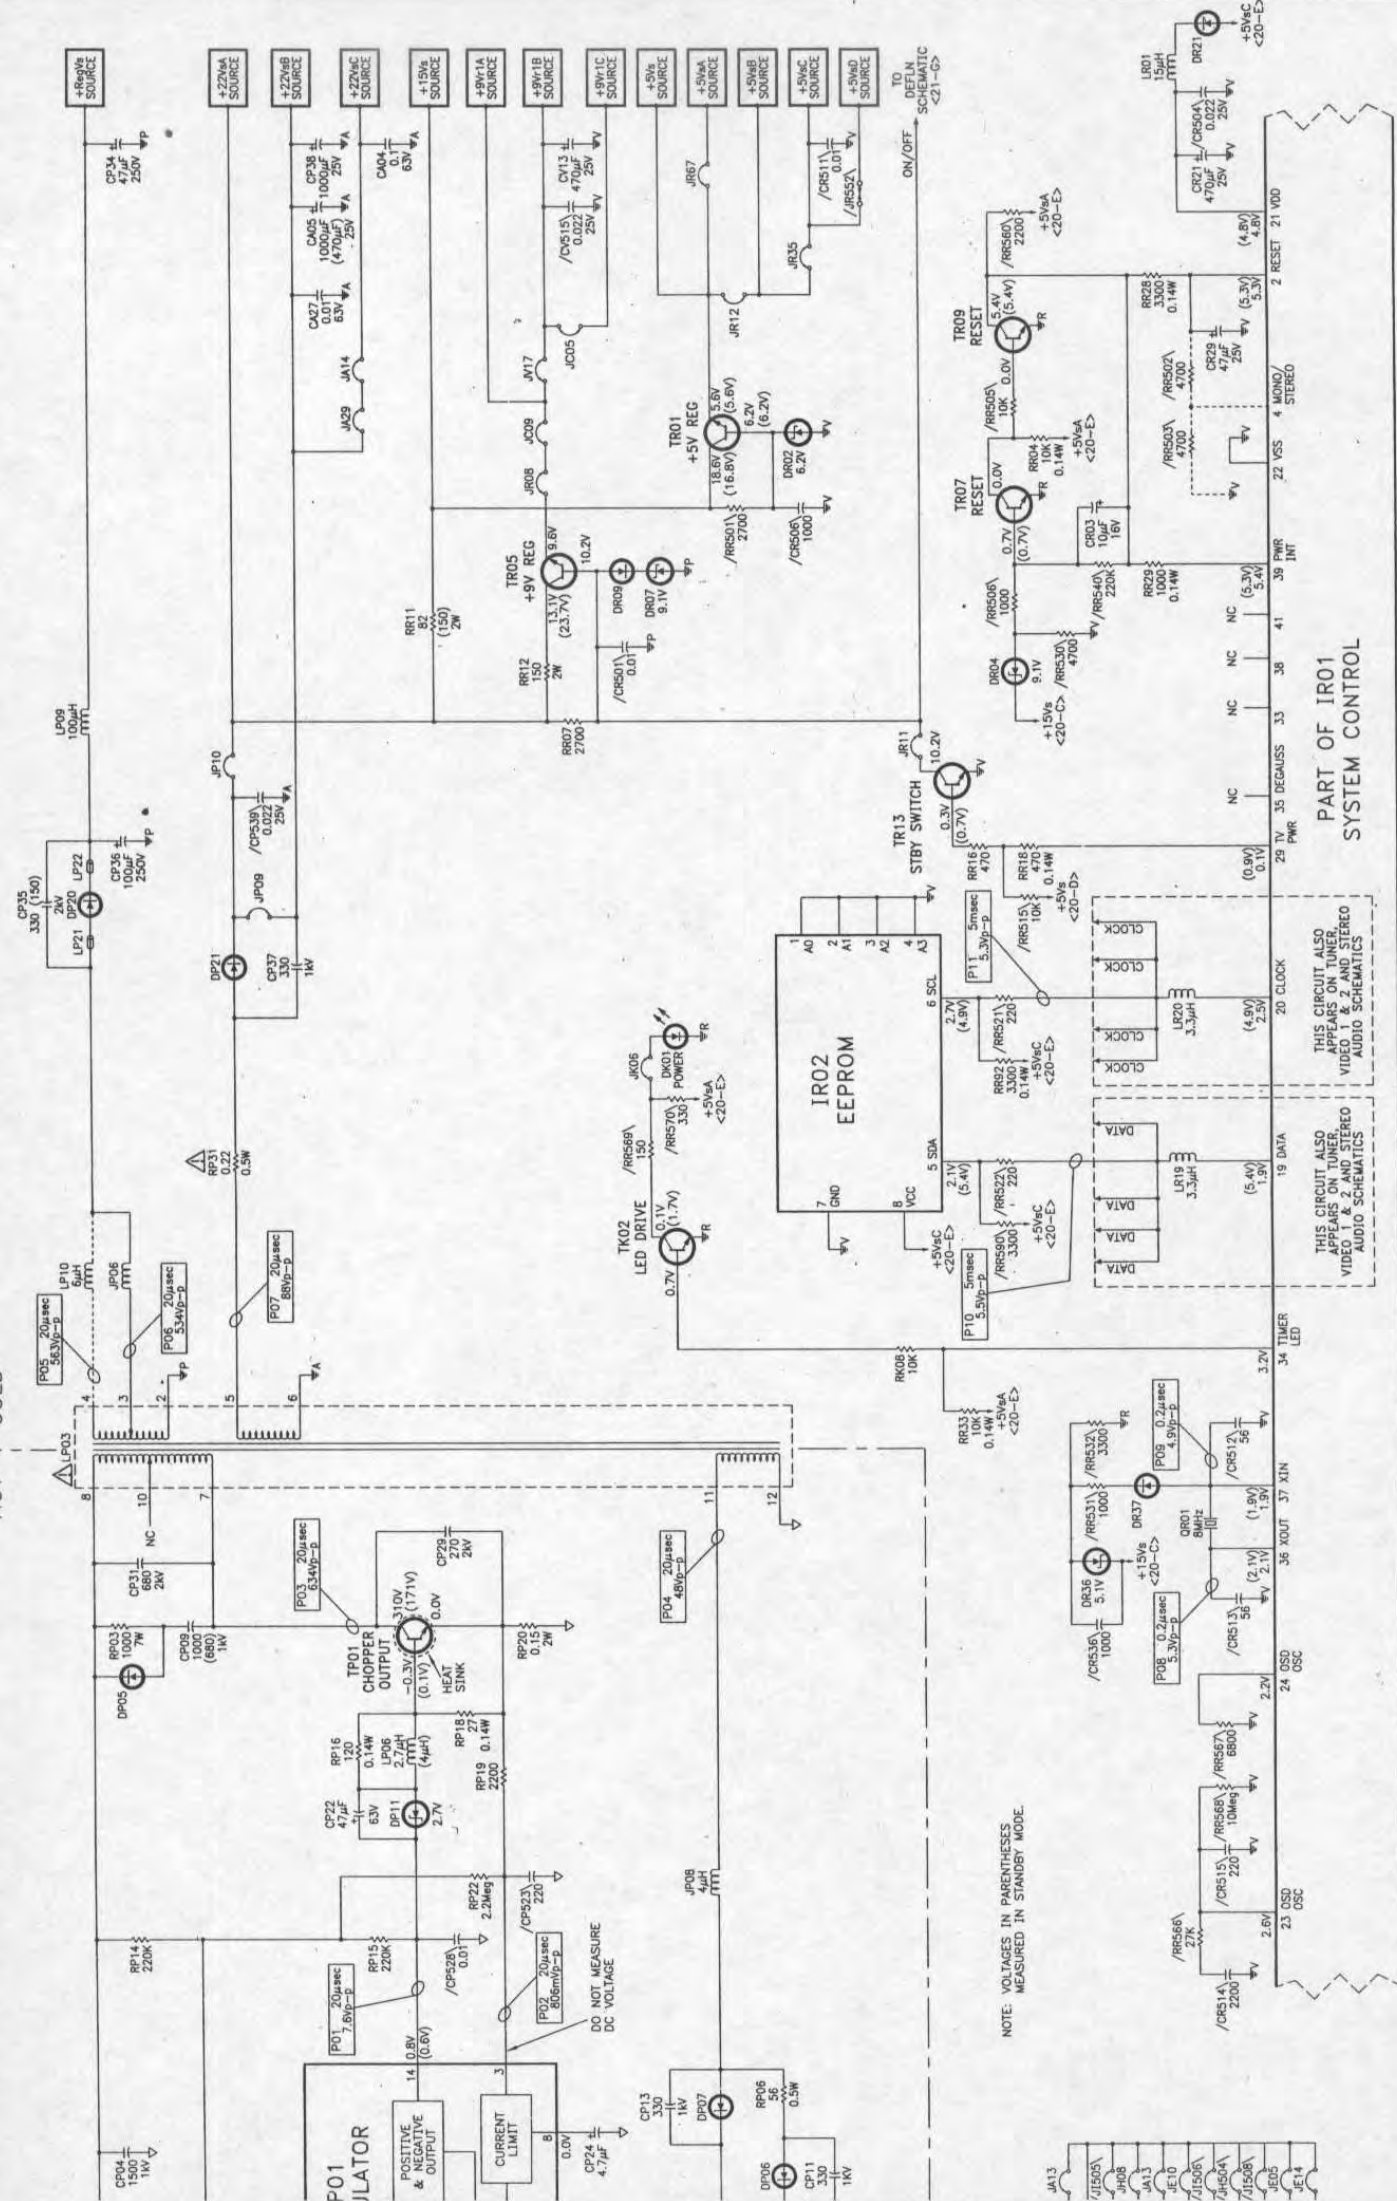

PART OF IR01
SYSTEM CONTROL


THIS CIRCUIT ALSO
APPEARS ON TUNER,
VIDEO 1 & 2 AND STEREO
AUDIO SCHEMATICS


THIS CIRCUIT ALSO
APPEARS ON TUNER,
VIDEO 1 & 2 AND STEREO
AUDIO SCHEMATICS

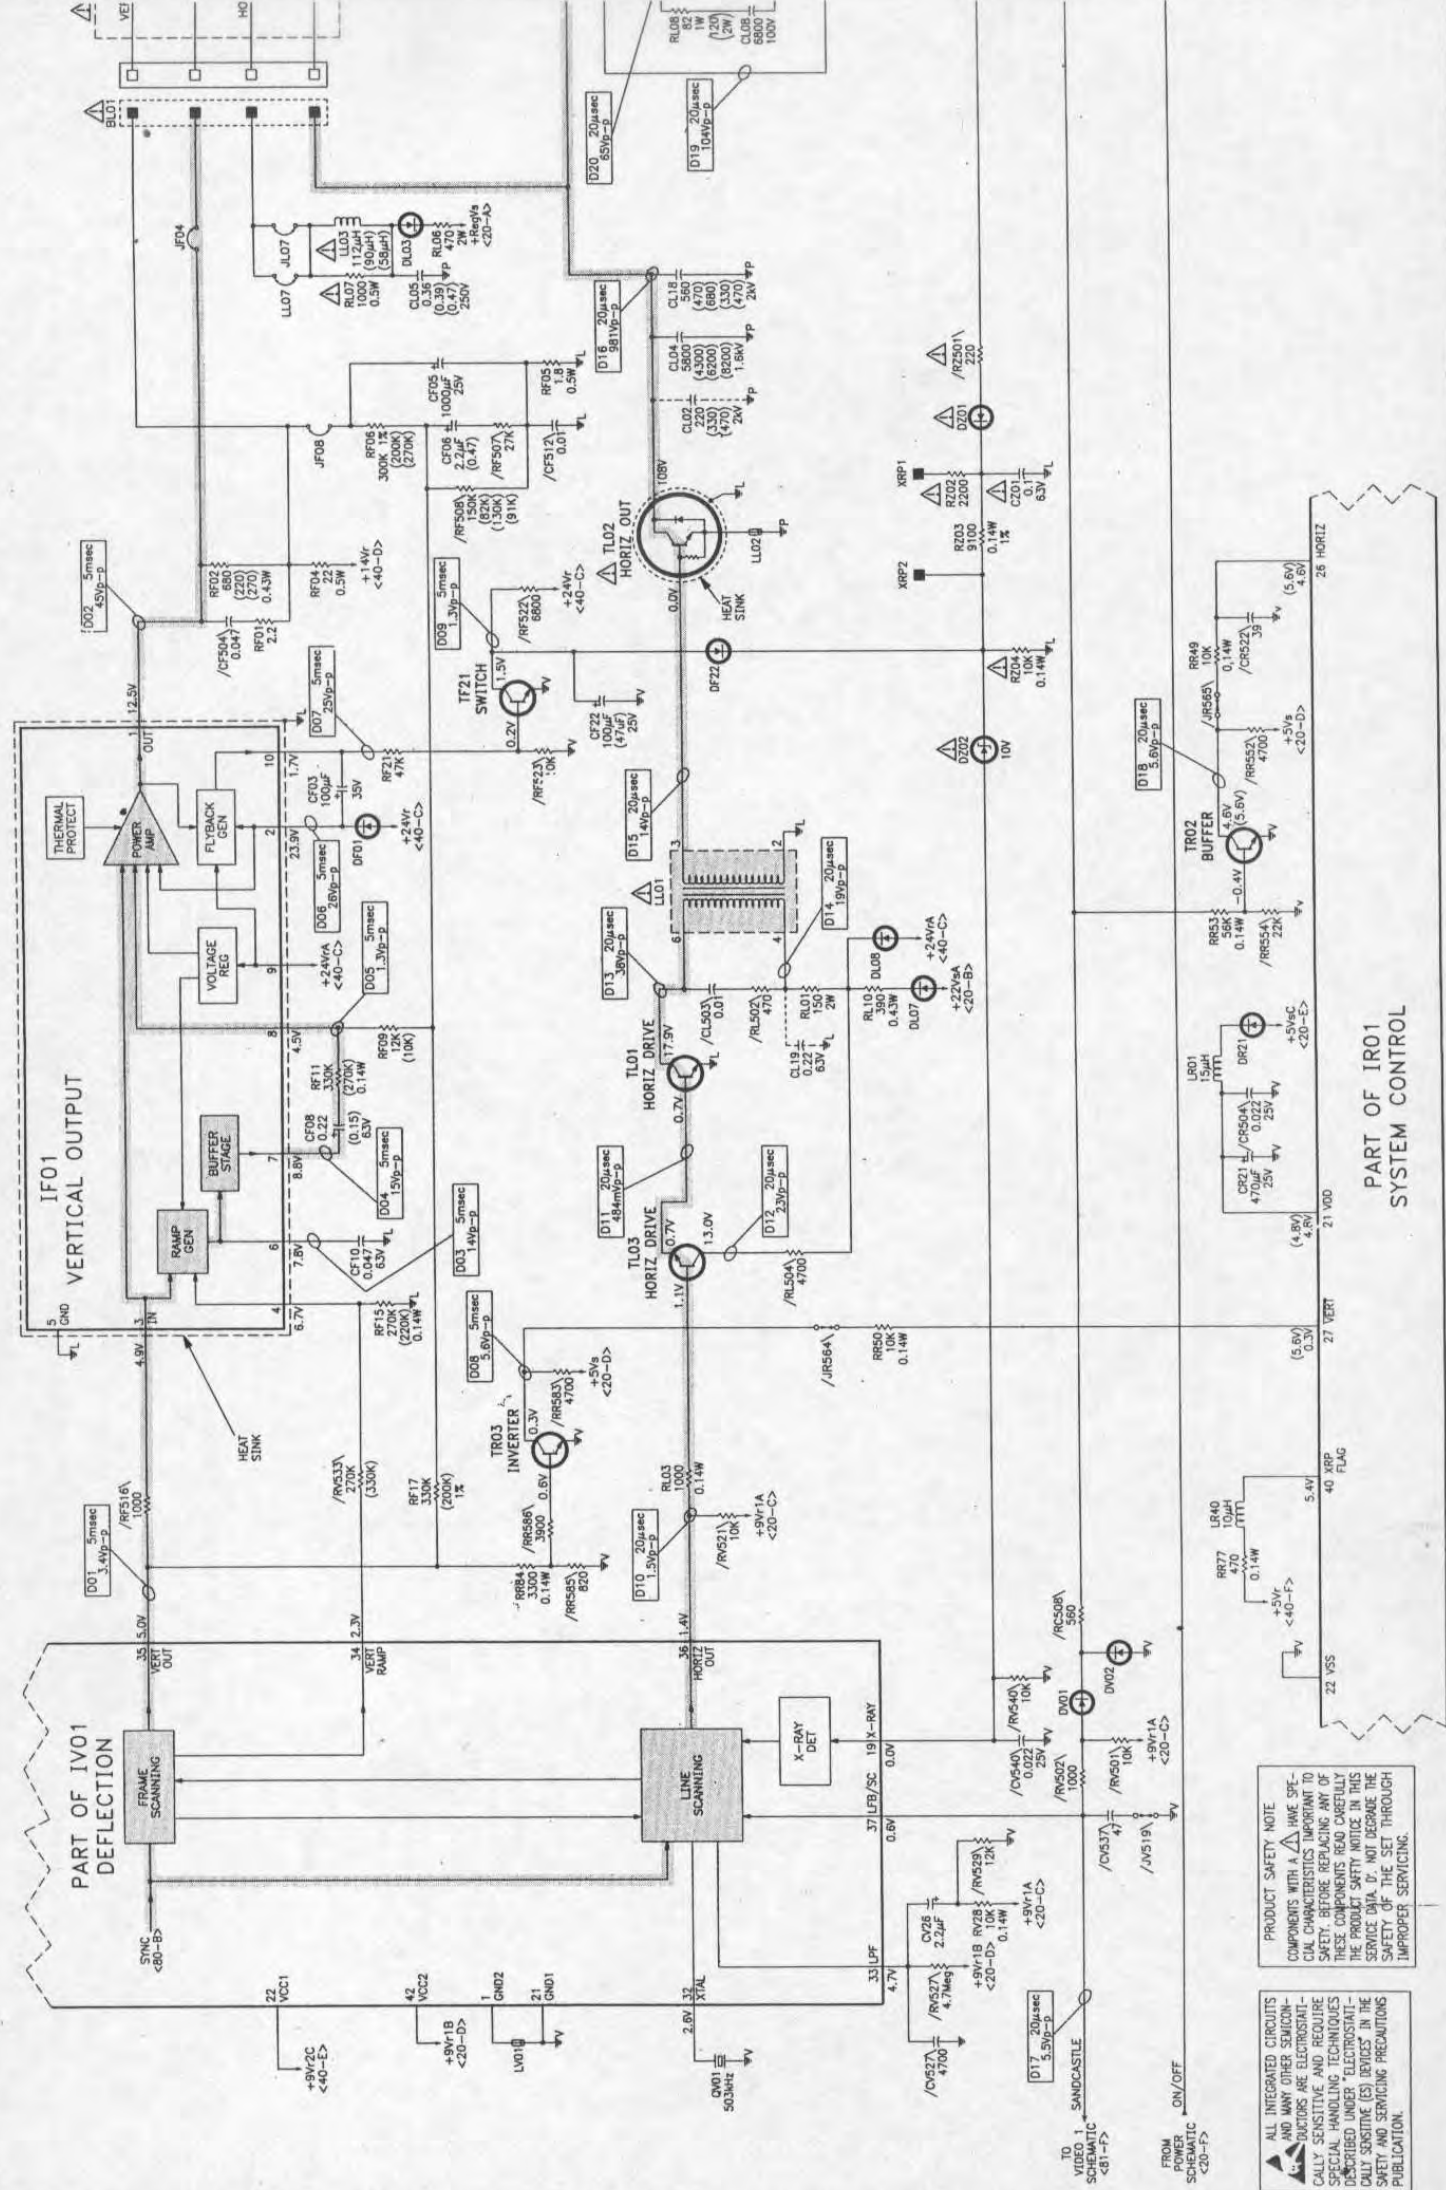

PRODUCT SAFETY NOTE
COMPONENTS WITH A Δ HAVE SPECIAL CHARACTERISTICS IMPORTANT TO SAFETY. BEFORE REPLACING ANY OF THESE COMPONENTS, READ CAREFULLY THE PRODUCT SAFETY NOTICE IN THE SERVICE DATA OF THE SET THROUGHOUT THE SAFETY AND SERVICING PRECAUTIONS PUBLICATION.

ALL INTEGRATED CIRCUITS AND MANY OTHER SEMICONDUCTORS ARE ELECTROSTATICALLY SENSITIVE AND REQUIRE SPECIAL HANDLING TECHNIQUES DESCRIBED UNDER "ELECTROSTATICALLY SENSITIVE (ES) DEVICES" IN THE SAFETY AND SERVICING PRECAUTIONS PUBLICATION.

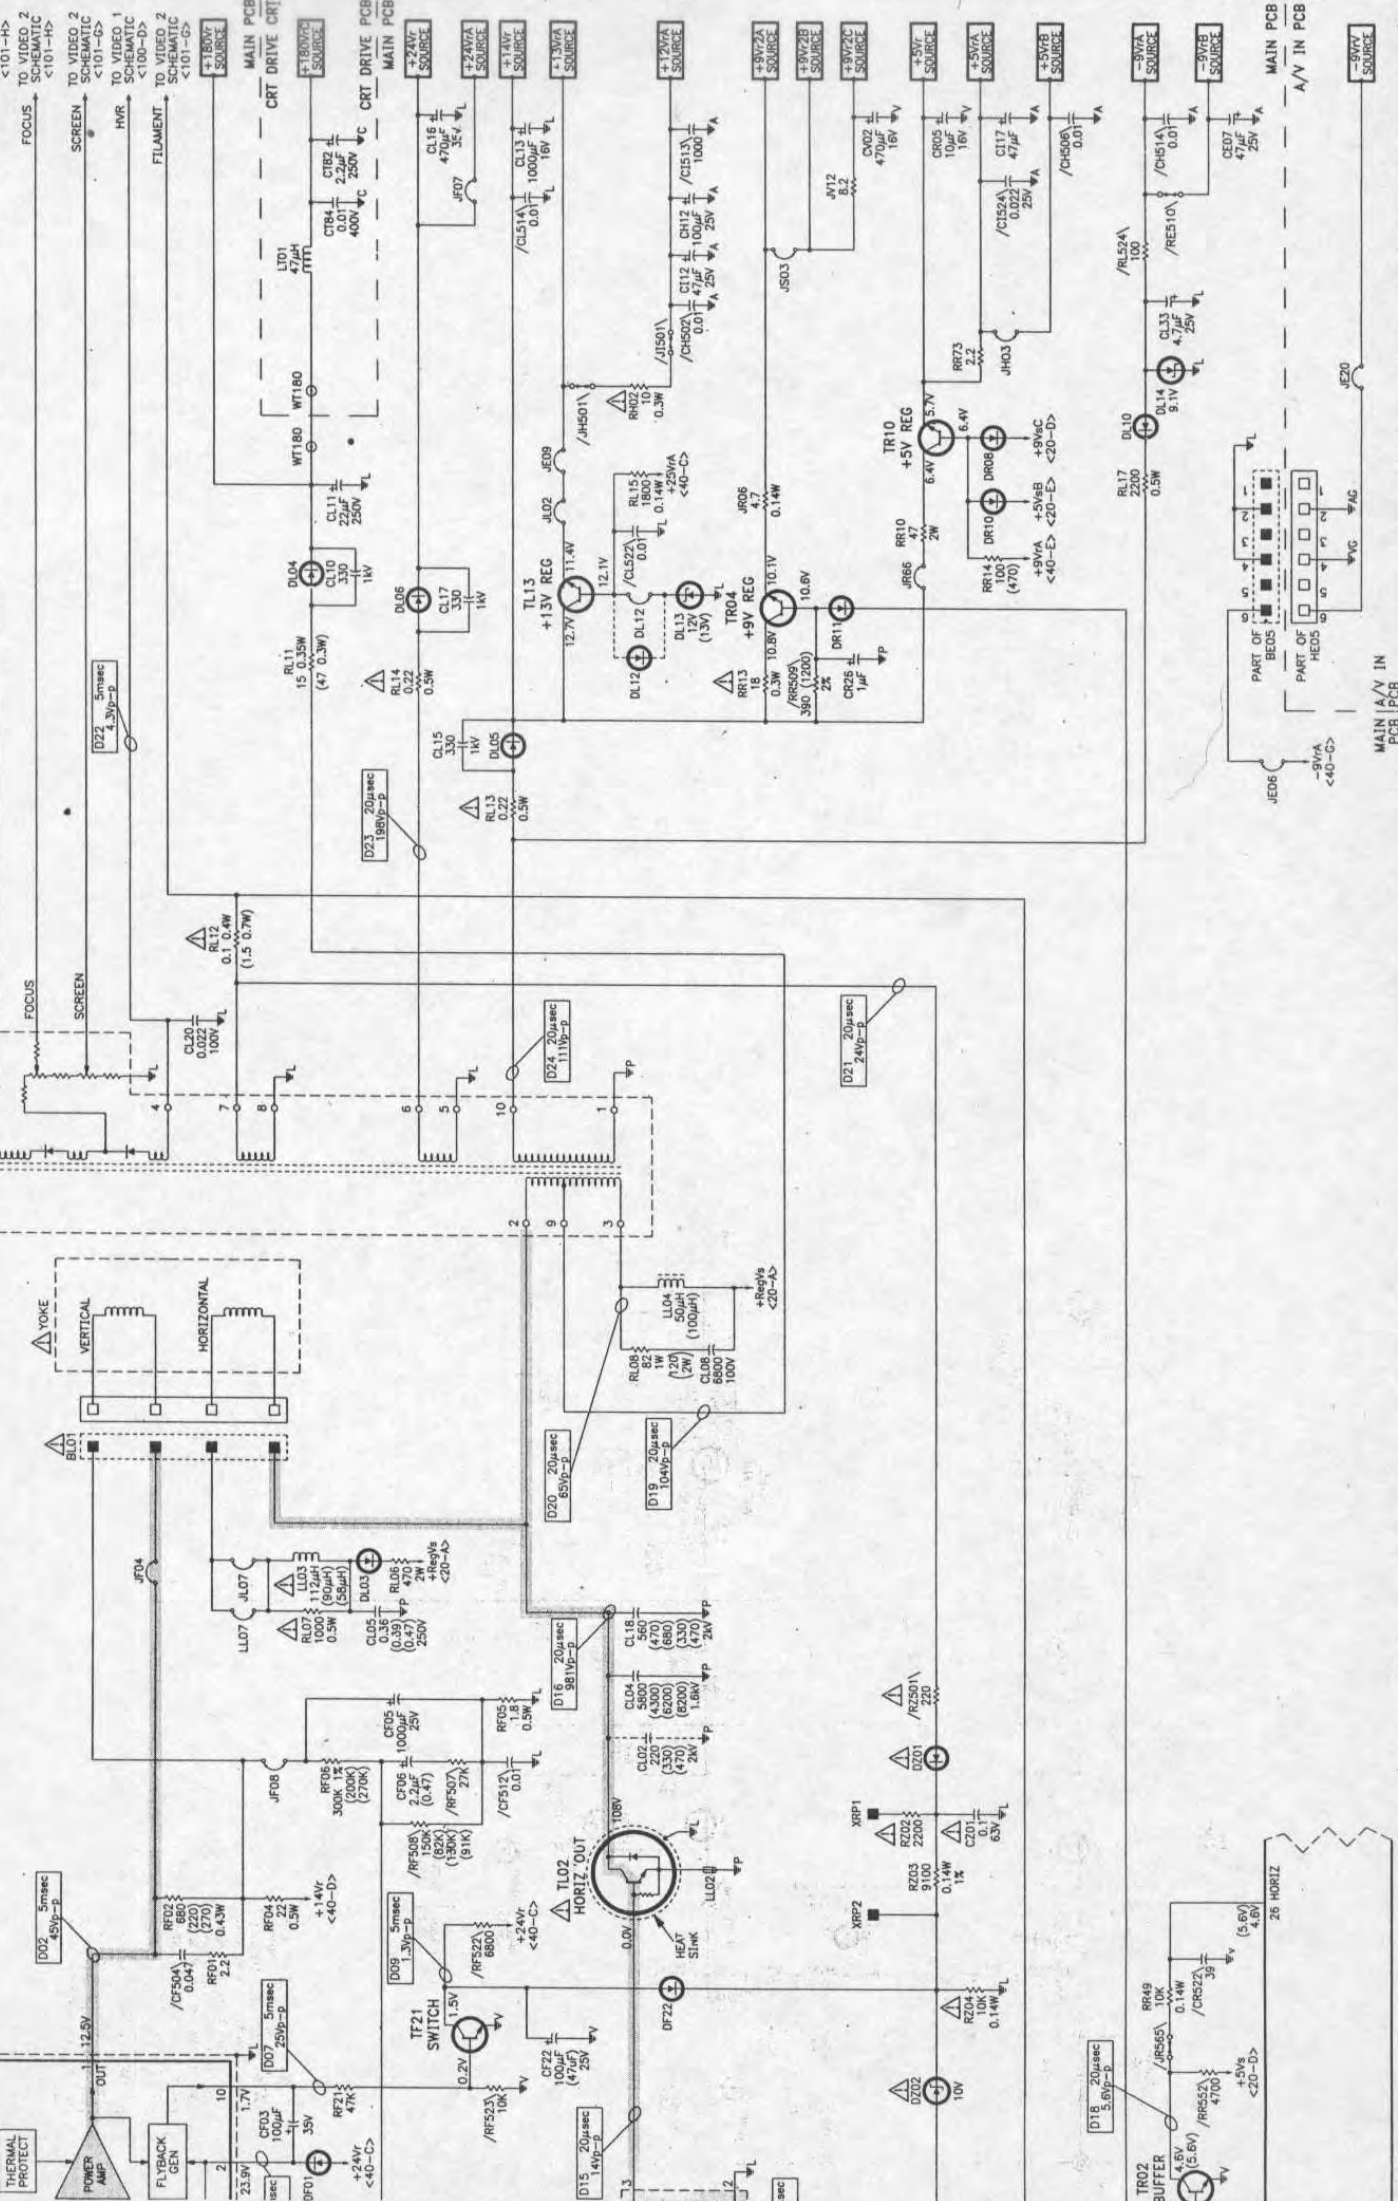


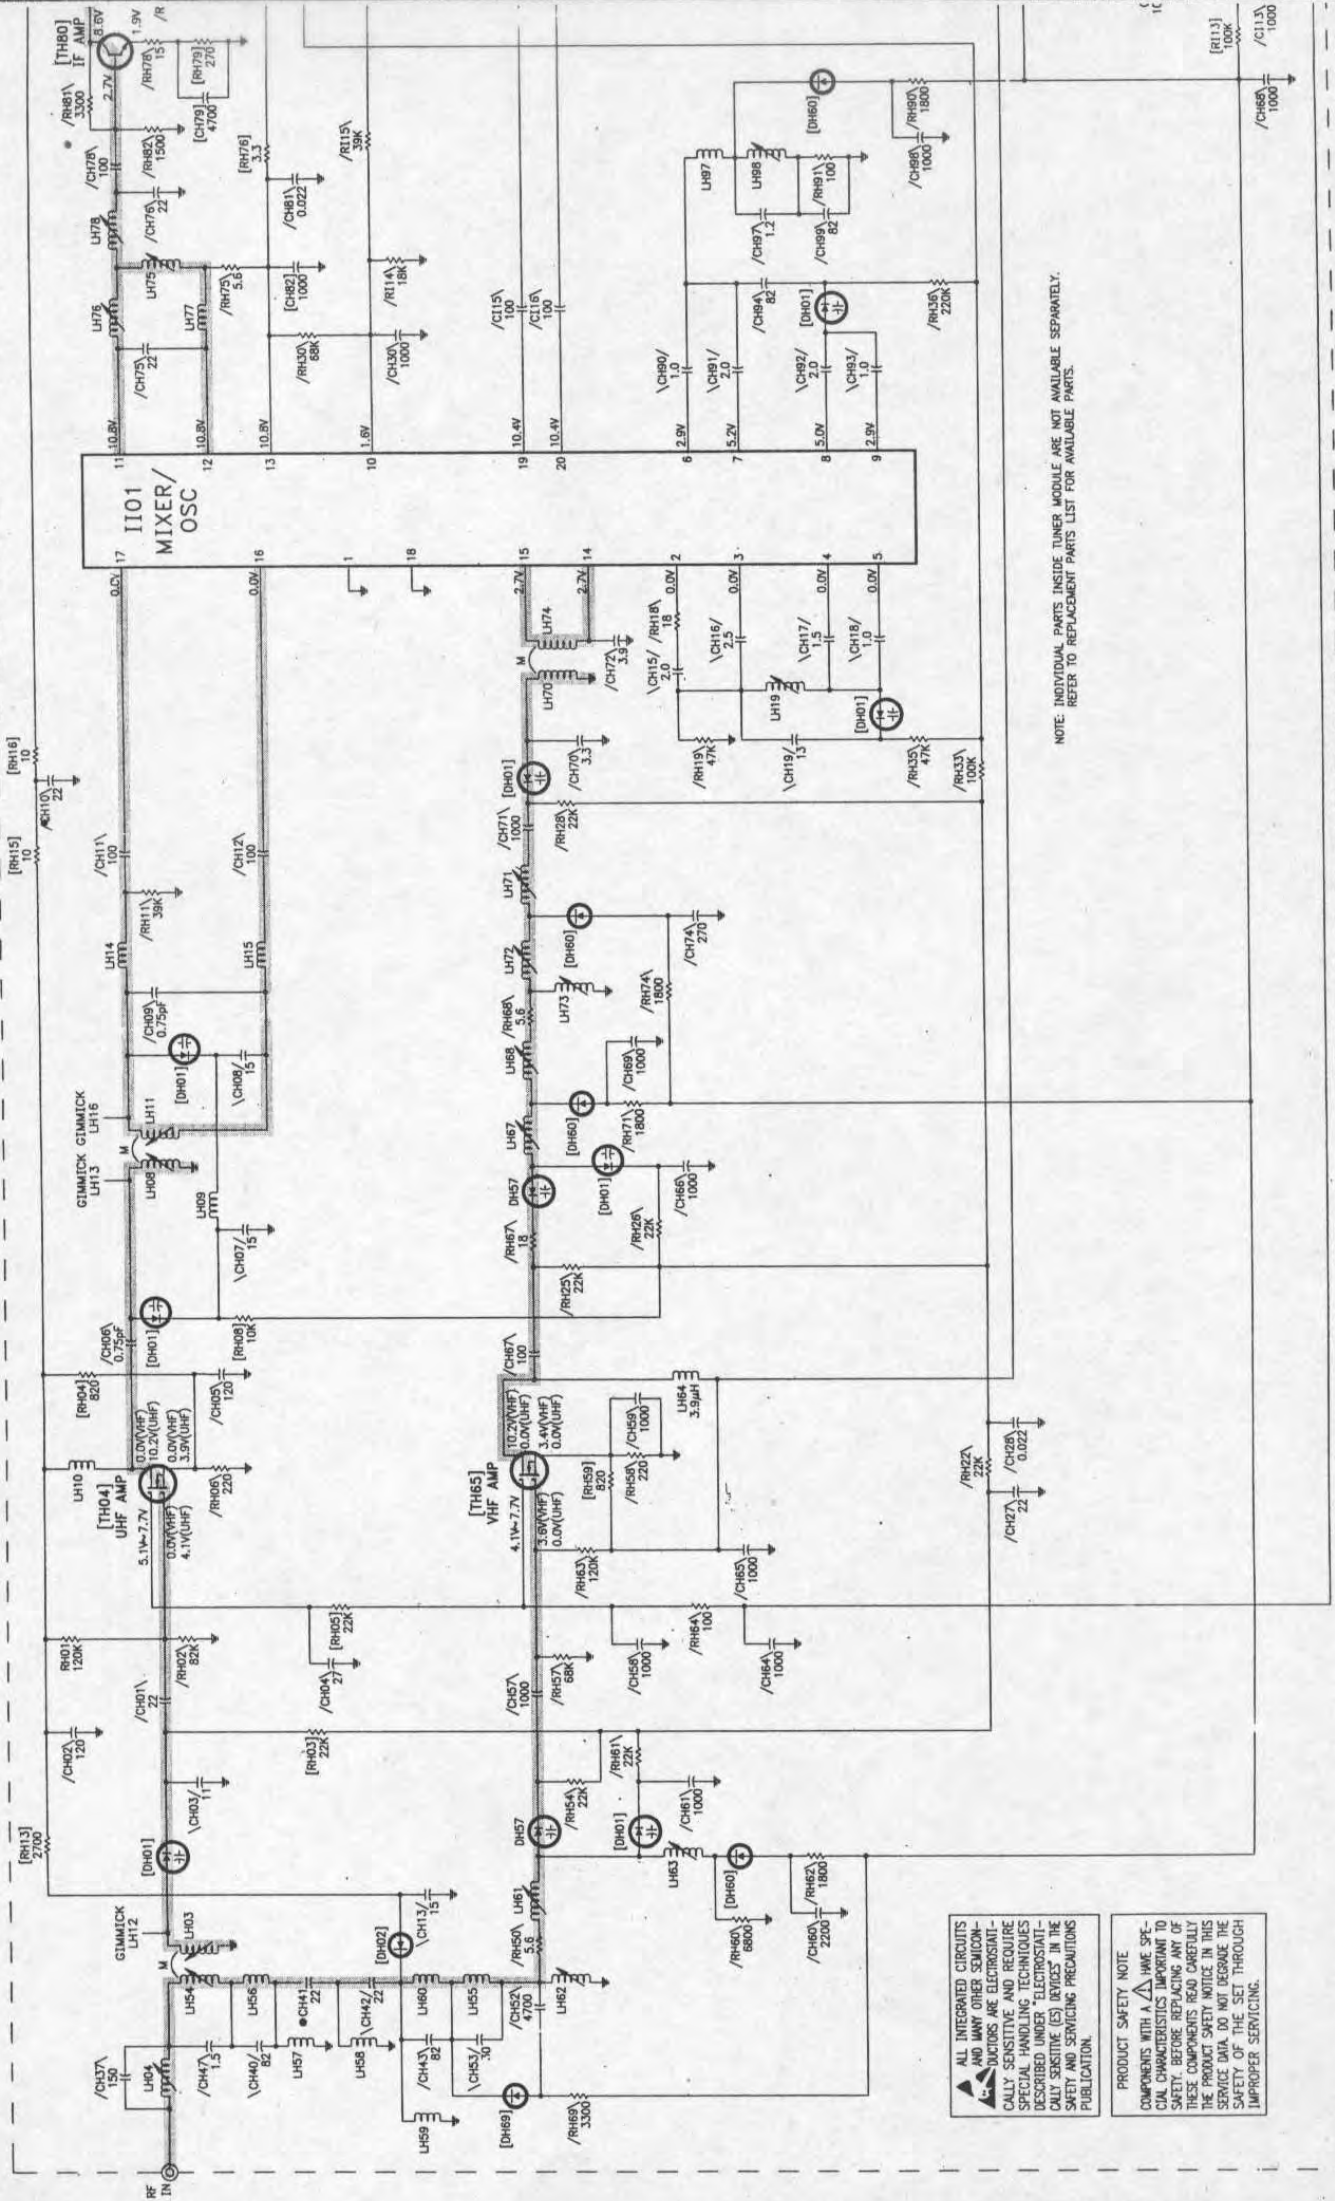

NOTE: INDIVIDUAL PARTS INSIDE TUNER MODULE ARE NOT AVAILABLE SEPARATELY.
REFER TO REPLACEMENT PARTS LIST FOR AVAILABLE PARTS.


ALL INTEGRATED CIRCUITS AND MANY OTHER SEMICONDUCTORS ARE ELECTROSTATICALLY SENSITIVE AND REQUIRE SPECIAL HANDLING TECHNIQUES DESCRIBED UNDER "ELECTROSTATICALLY SENSITIVE (ES) DEVICES" IN THE SAFETY AND SERVICING PRECAUTIONS PUBLICATION.


PRODUCT SAFETY NOTE
COMPONENTS WITH A Δ HAVE SPECIAL CHARACTERISTICS IMPORTANT TO SAFETY. BEFORE REPLACING ANY OF THESE COMPONENTS READ CAREFULLY THE PRODUCT SAFETY NOTICE IN THIS SERVICE DATA. DO NOT DEGRADE THE SAFETY OF THE SET THROUGH IMPROPER SERVICING.

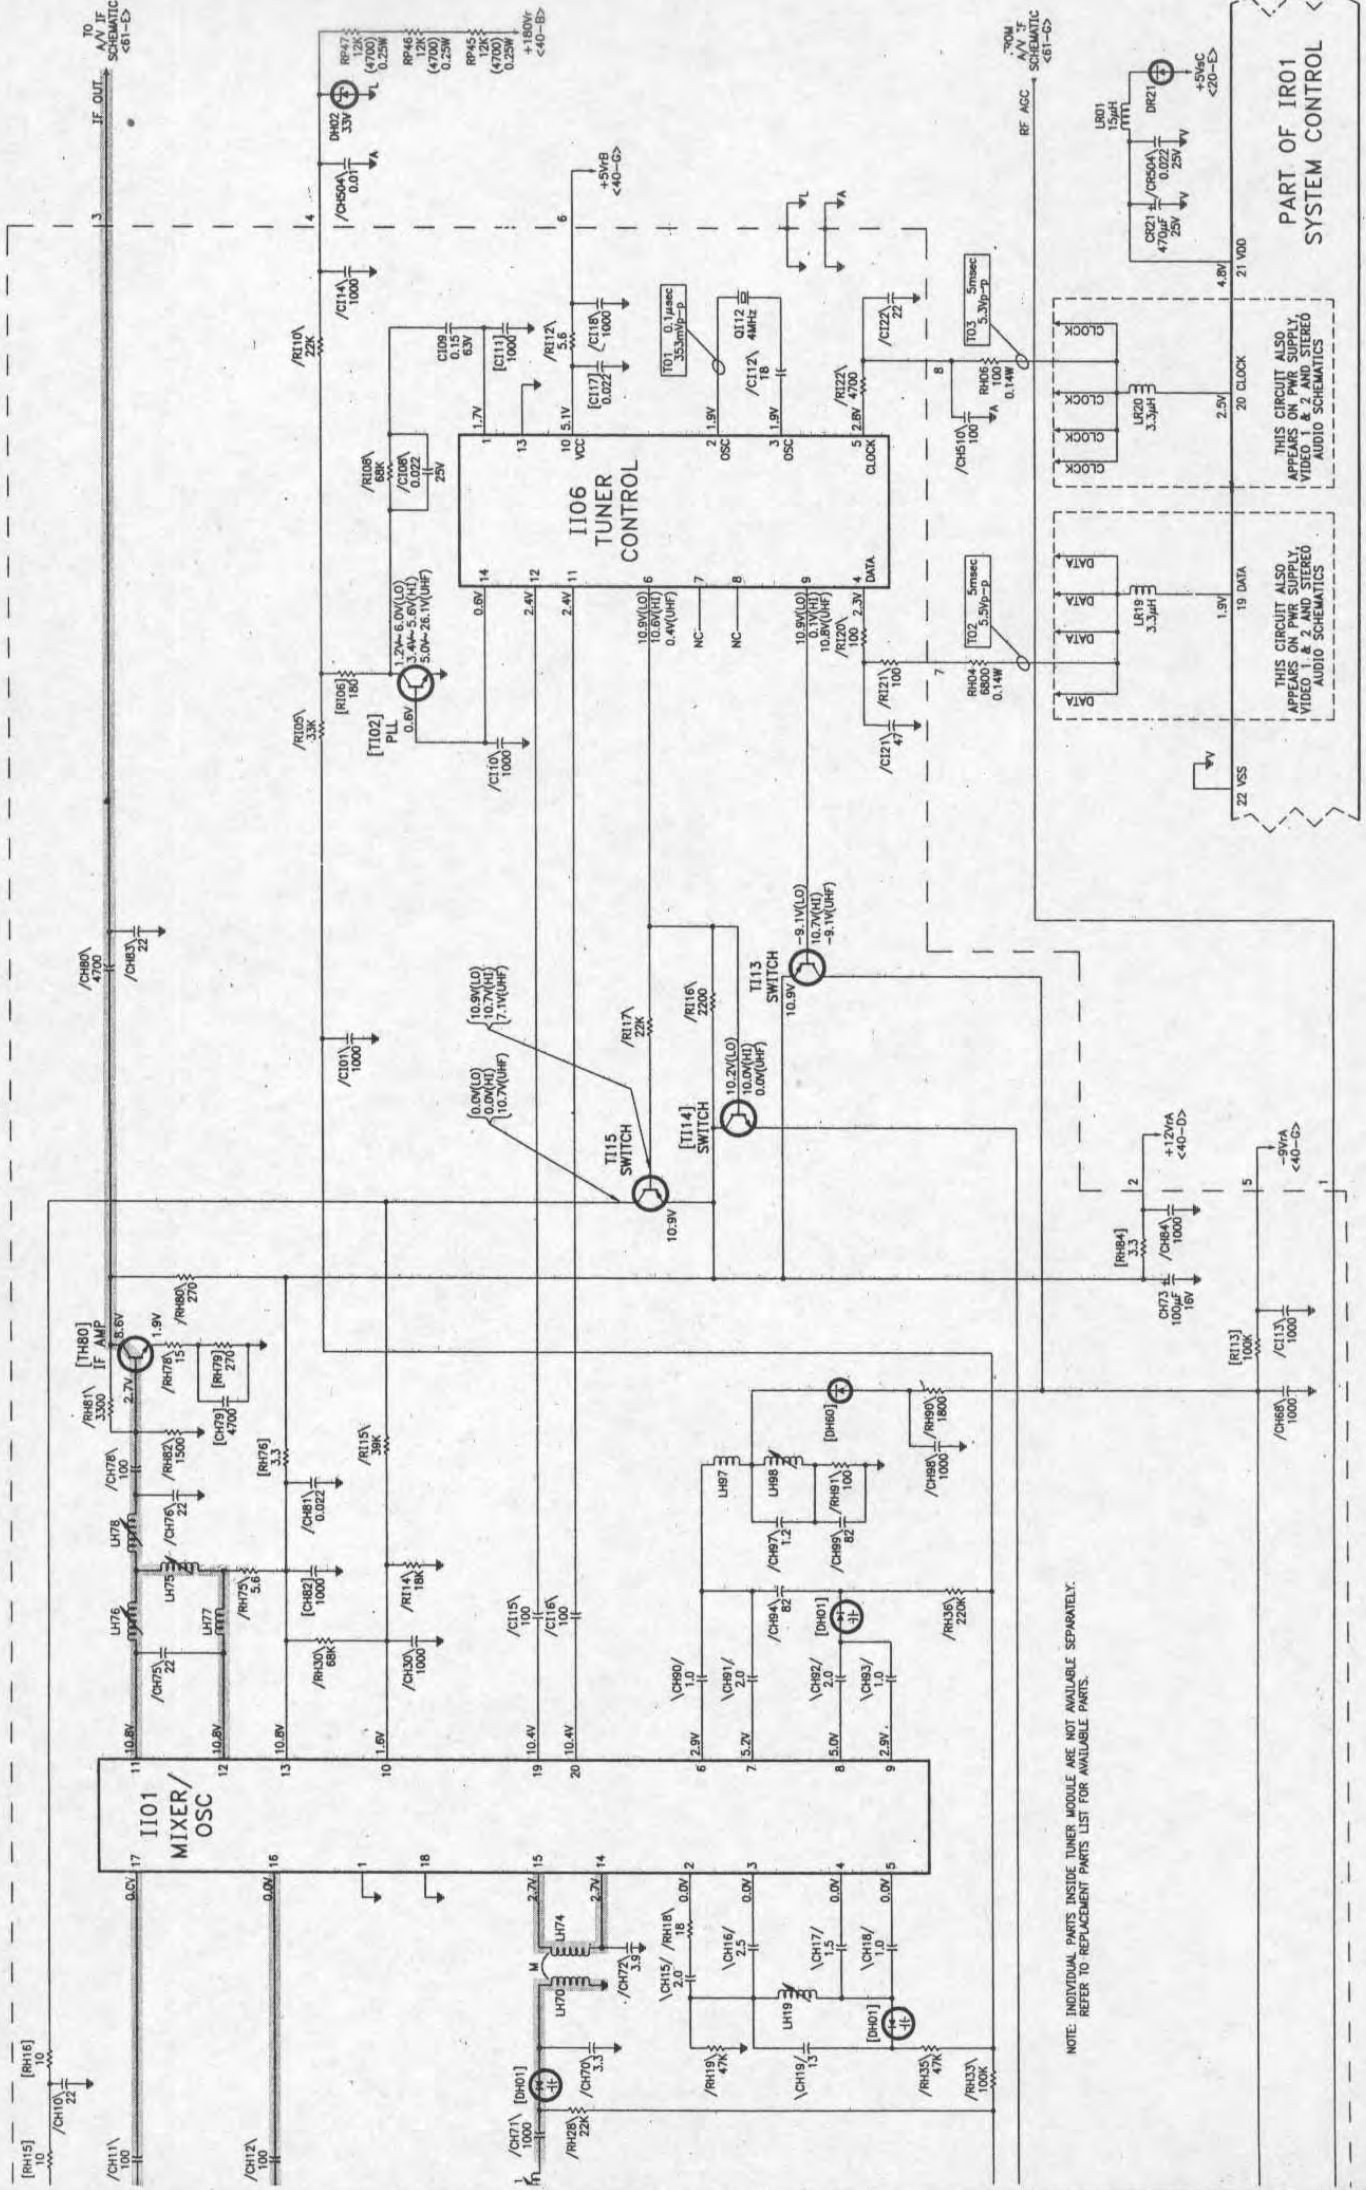

NOTE: INDIVIDUAL PARTS INSIDE TUNER MODULE ARE NOT AVAILABLE SEPARATELY.
REFER TO REPLACEMENT PARTS LIST FOR AVAILABLE PARTS.


PART OF IR01 SYSTEM CONTROL

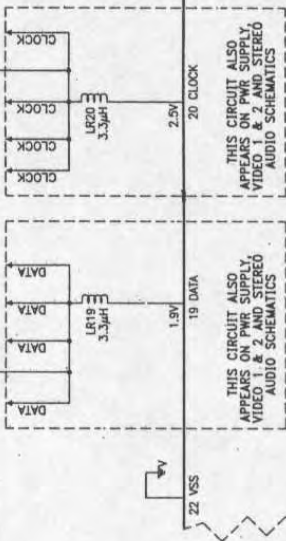


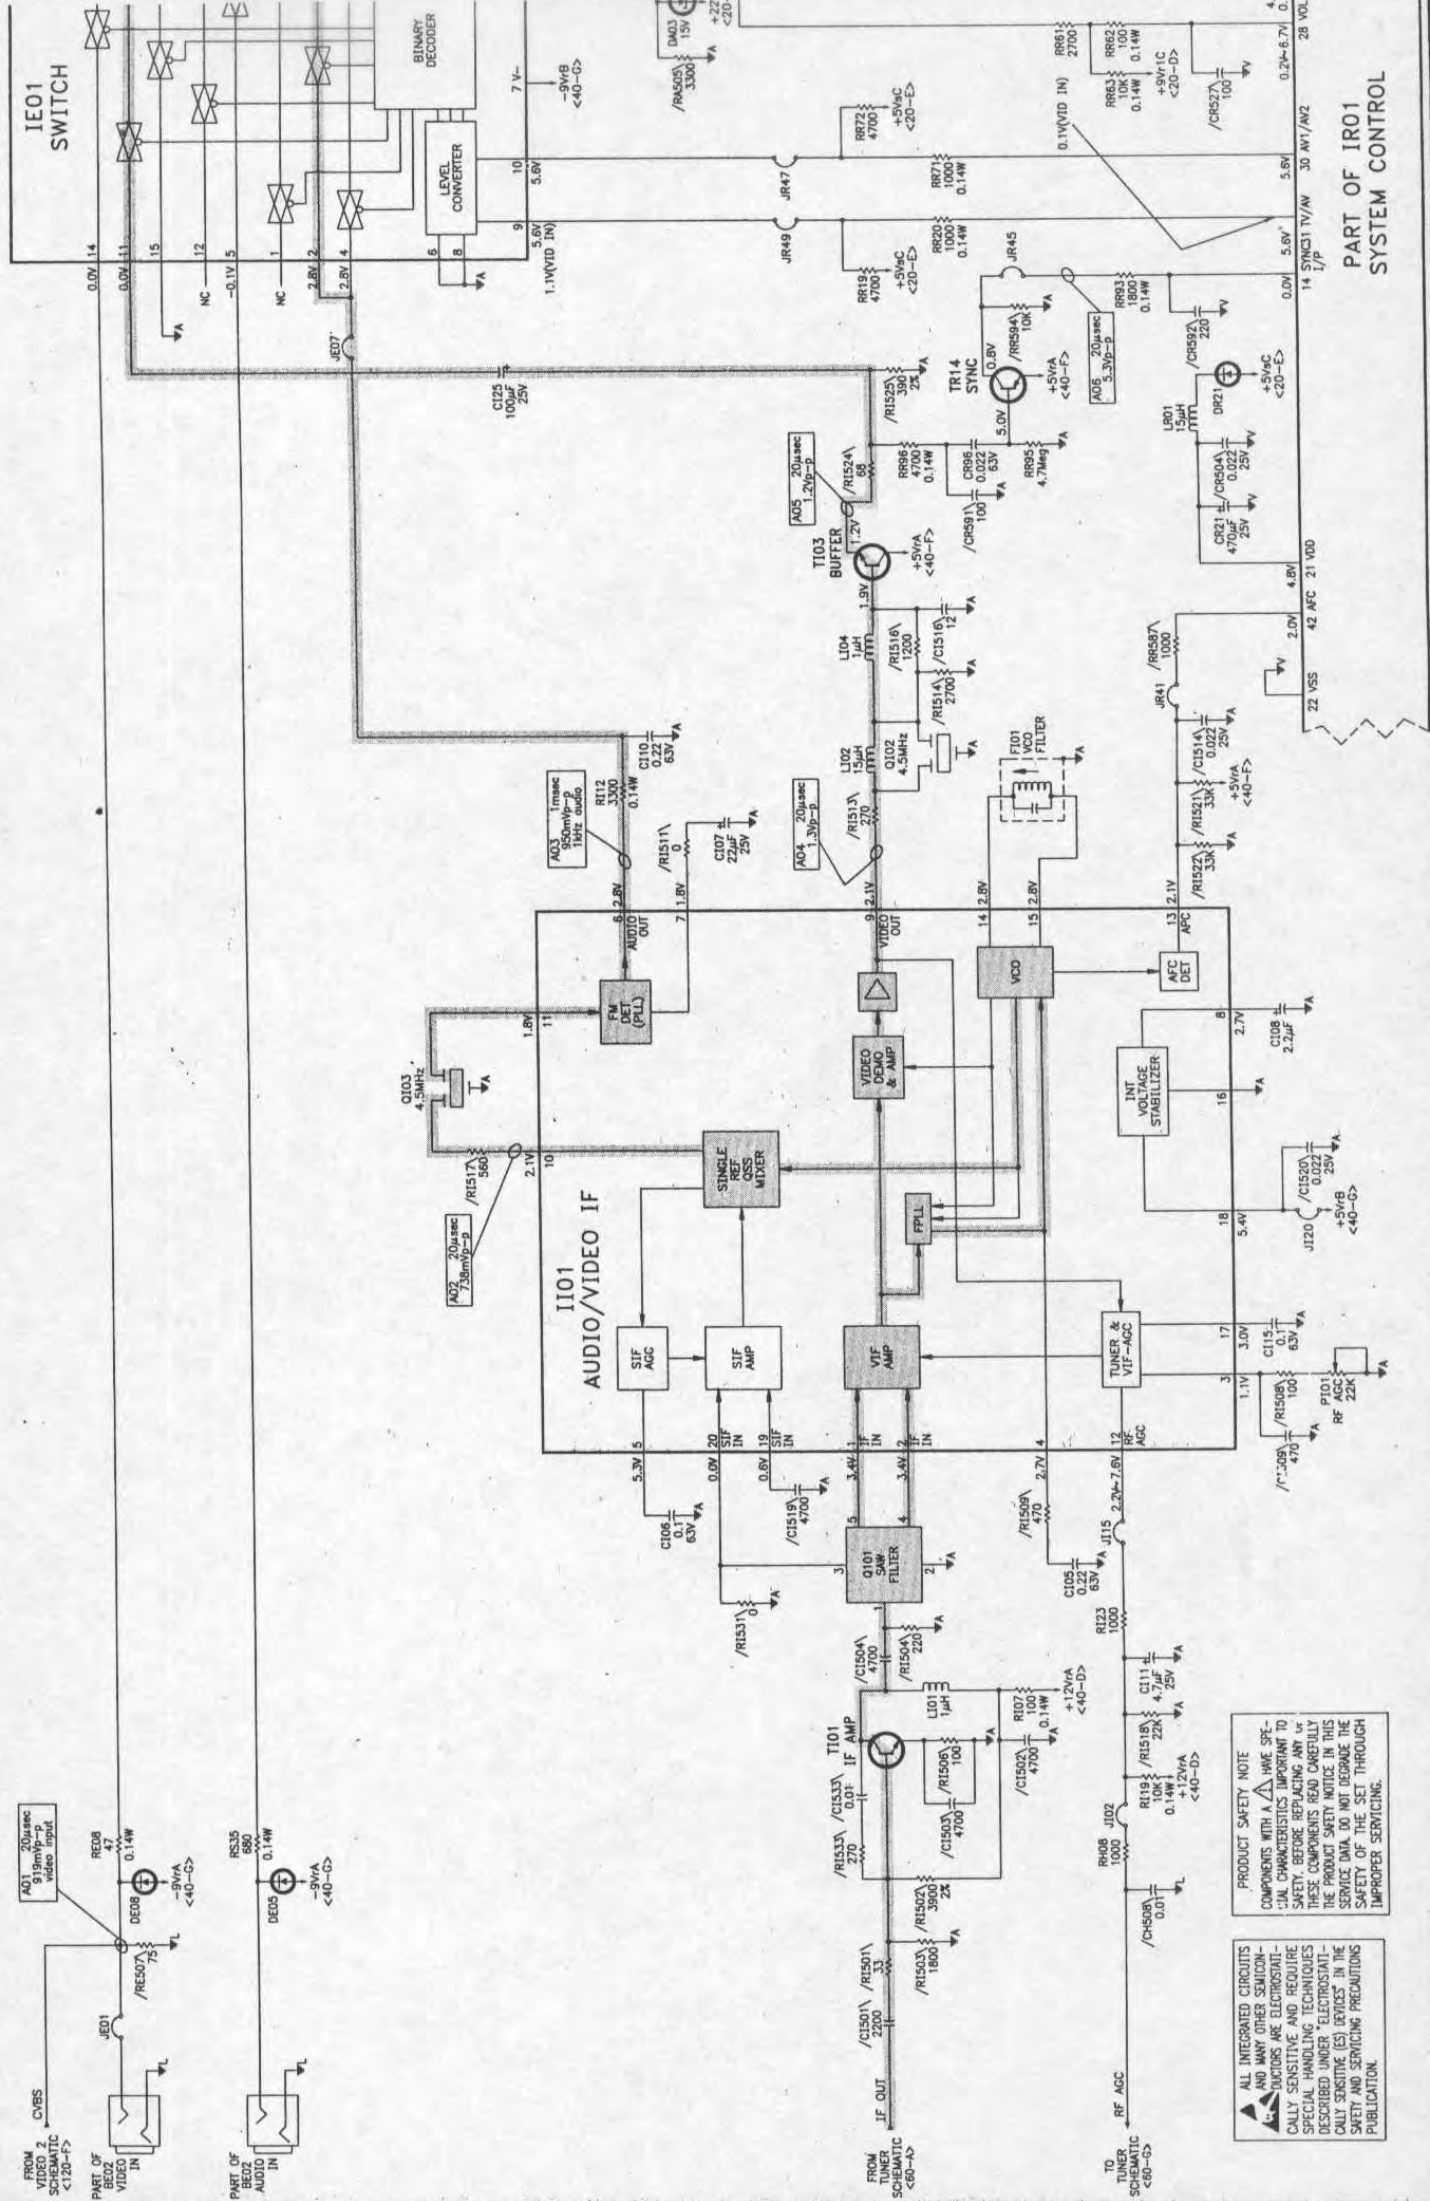


PRODUCT SAFETY NOTE
ALL INTEGRATED CIRCUITS AND MANY OTHER SEMICONDUCTORS ARE ELECTROSTATICALLY SENSITIVE AND REQUIRE SPECIAL HANDLING TECHNIQUES DESCRIBED UNDER "ELECTROSTATICALLY SENSITIVE (ES) DEVICES" IN THE SAFETY AND SERVICING PRECAUTIONS PUBLICATION.

COMPONENTS WITH A Δ HAVE SPECIAL CHARACTERISTICS IMPORTANT TO SAFETY. BEFORE REPLACING ANY OF THESE COMPONENTS READ CAREFULLY THE PRODUCT SAFETY NOTICE IN THIS SERVICE DATA. DO NOT DEGRADE THE SAFETY OF THE SET THROUGH IMPROPER SERVICING.

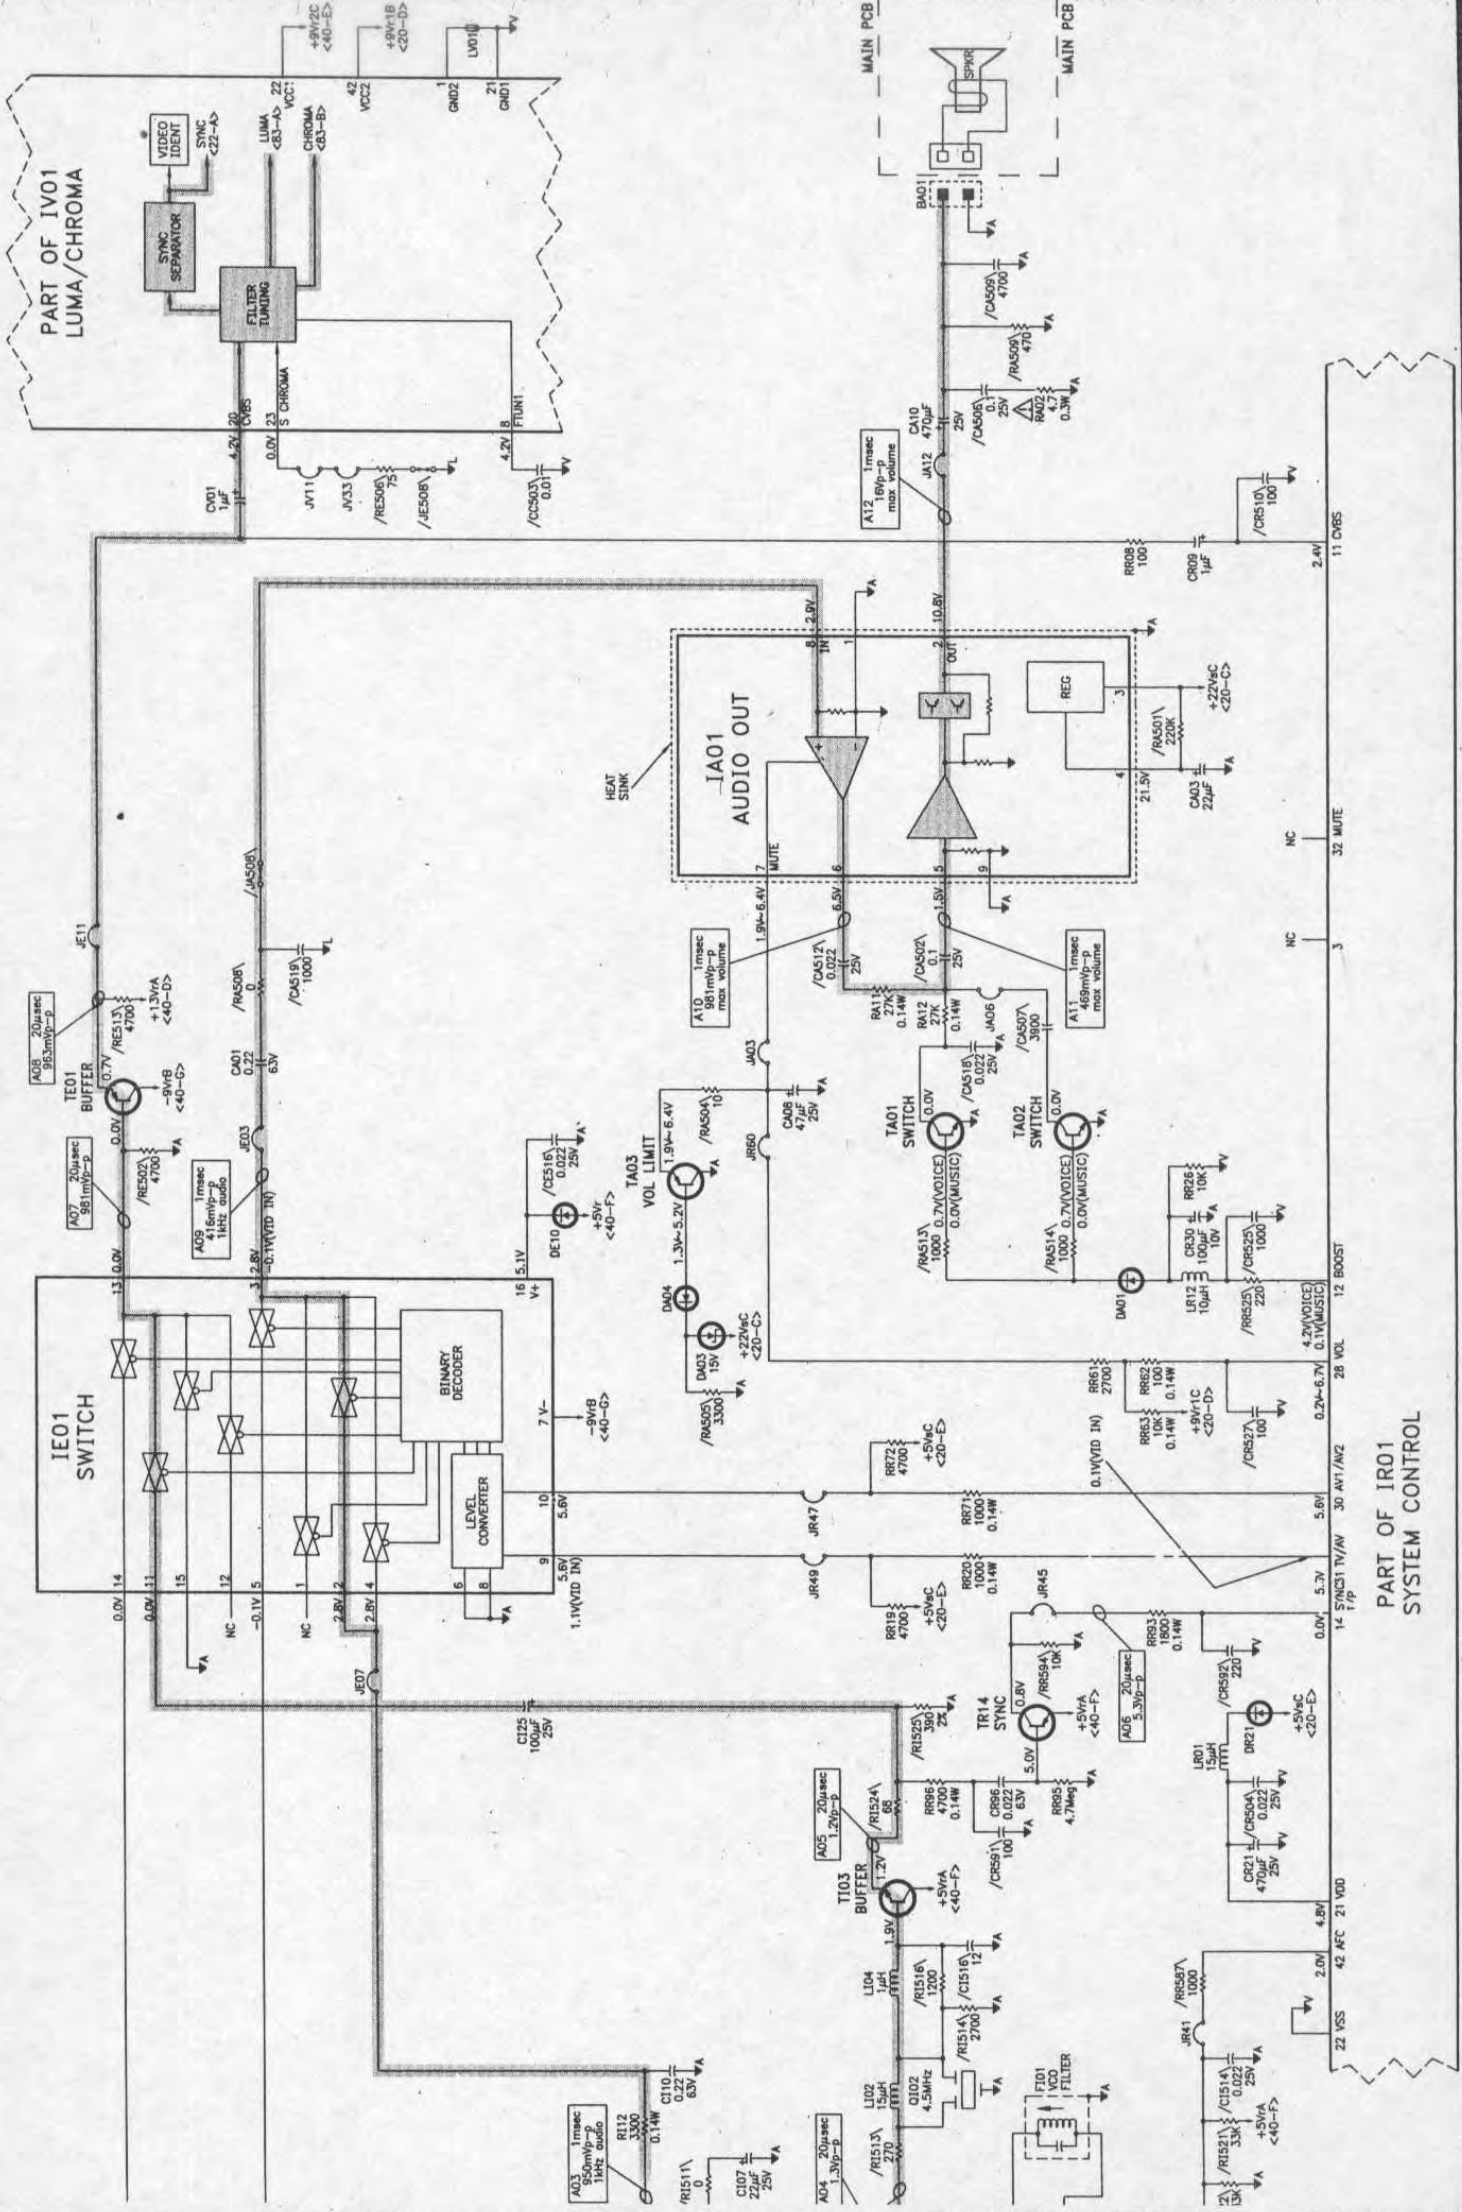



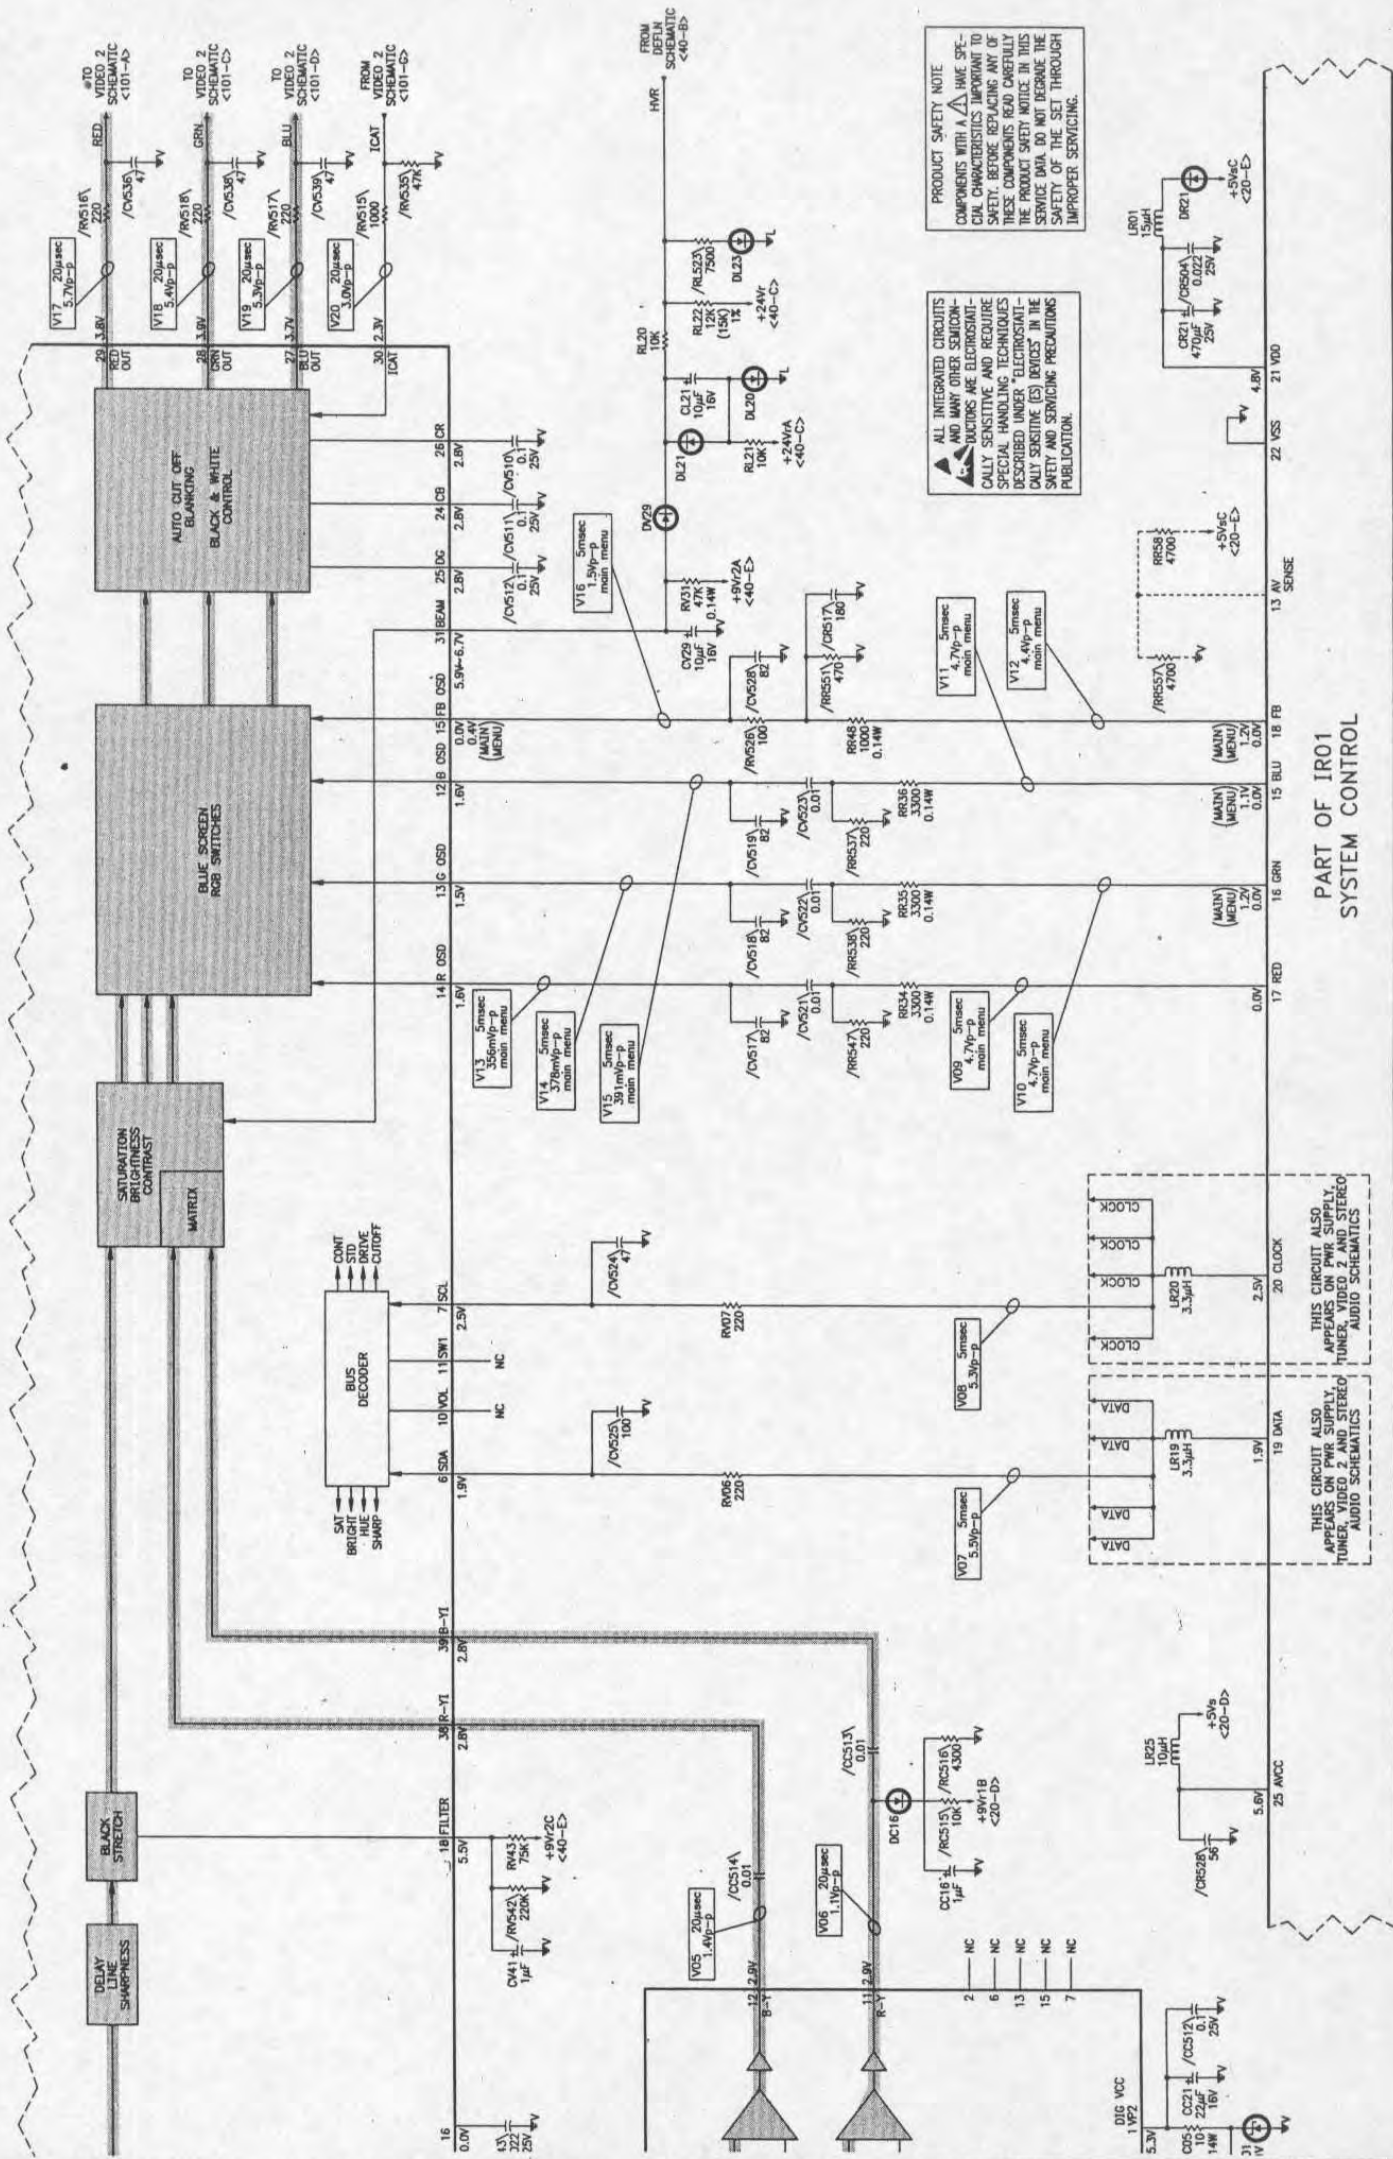



MOD: GE 14091/GE 20091

